FIELD SERVICE GUIDE FOR IFT 2.0 CONTROL SYSTEM

Intelli[®]Fire[™]Touch

2.0

Ignition System With Wireless Controls

The latest version of the groundbreaking IntelliFire system, continuing to make operating your fireplace safe, easy, and smart.

Introduction

This document provides detailed information for effective service of the IntelliFire® Touch (IFT) 2.0 Control System. The information in this document is intended for qualified service technicians and support personnel.

Service technicians must follow appropriate codes, follow manufacturer's installation instructions, and use specified replacement parts and materials when servicing gas appliances. Service parts are subject to change at any time. Refer to the service parts list for the appliance for specified replacement parts.

Technical Assistance – Dealers & Distributors

Hearth & Home Technologies 1-855-CALLHHT (225-5448)

Contact Technical Service for the appropriate brand dedicated to trade channel partners. Do not provide this contact information to consumers or builders. Be prepared to provide the following information:

Model and Serial # Detailed problem description Previous service history or HHT Reference #

Reference the warranty policy and coverage in the appliance manual. RMA requirements are subject to change.

Table of Contents / Quick Reference

1.	IFT 2.0 System ECM and PACM	4
2.	ECM, ACM, PACM Power Connections	4
3.	ECM & ACM Features and Descriptions	5
4.	Remote Control Pairing Instructions and FAQ	6
5.	Remote Control Pairing Procedure	7
6.	Re-Pairing RC450 after adding an IFT-ACM, optional RC150U, Fan Kit, Lights Kit, Power Vent, or Heat Management.	7
7.	IFT 2.0 Pairing FAQ's	8
8.	IFT 2.0 Troubleshooting Diagnostics	11
9.	Gas Valve Troubleshooting	12
10.	AC/DC Adapter Troubleshooting	15
11.	Pilot Ignition Troubleshooting	16
12.	Pilot Flame Sense Rectification Troubleshooting	18
13.	Power Vent and Heat Management Port Error Handling	22
14.	Removing Power Vent or Heat Management ports from an appliance	22
15.	FAQ/Troubleshooting IFT 2.0 Controls with Power Vent	23
16.	FAQ/Troubleshooting – Appliance Controlled with RC150U Wireless Wall Switch	24
17.	FAQ/Troubleshooting – Appliance Controlled with IFT-RC450	25
18.	Wi-Fi Module and Mobile App Info and Troubleshooting	30
19.	Wi-Fi Module Status LED	33
20.	Mobile App Screen Messages Corrective Action	34
21.	Trouble Shooting Mobile App	36
22.	Additional Troubleshooting Resources and Videos	39

IFT 2.0 Control System Overview

This fireplace control system consists of the following components:

Ignition and Control Components

- Electronic Control Module (ECM): This is the primary control for the system. It controls ignition spark voltage, gas valve voltages, IPI pilot flame sensing, and other consumer-directed functions.
- AC/DC Adapter: This component transforms 120VAC power from the junction box to 6VDC as the primary power source to the ECM.
- **IPI Pilot Assembly**: Provides ignition spark discharge, pilot flame, and flame sense electrode.
- Gas Valve: Provides gas supply to the IPI Pilot and regulates gas supply to the main burner.
- **Multi-wire Harness**: Connects the ECM to the gas valve, chassis ground, back-up battery pack, and optional switch configurations including the Power Vent Pressure Switch.
- **Back-up Battery Pack**: Optional power source for use during power outages. Not intended as a primary power source. Cannot be used with Power Vented appliances or other models that may be exempt. May be used in combination with BATTERY-WSK or standalone.

Auxiliary Control Components

- Auxiliary Control Module (ACM): Provides voltage control to optional peripheral loads, including one Fan, one Power Vent Kit, a Secondary Burner, and/or Lights. The ACM connects to the ECM. The ACM is powered by a separate 120VAC cord connected to the junction box.
- **Premium Auxiliary Control Module (PACM):** Provides voltage control to additional, optional peripheral loads, including up to 4 Heat Management ports, Power Vent kit, Colored or Clear Accent Lighting, a Secondary Burner, and Ember Bed Lighting. The PACM is powered by a separate 120VAC cord connected to the junction box.
 - NOTE: Only an ACM or PACM may be used in conjunction with a single ECM. It is not possible to install both. Please refer to the feature content supported to determine whether the ACM or PACM should be used.

Wireless Control Components

- **RF Module**: Provides wireless radio-frequency capability to the ECM. The RF module must be connected to the ECM to communicate with the RC450 or RC150U remote controls.
 - NOTE: The RFM has 2.0 specific connections and ports, an older RFM (2326-120 or 2565-120A3) cannot be used.
- **RC450**: Multifunction 'touchscreen' remote control for the fireplace and all connected peripherals.
- **RC150U**: Wireless wall switch, with ON/OFF and cold-climate switching function
- **Wi-Fi Module**: Provides 2.4 GHz Wi-Fi connectivity to iOS/Android Apps to the ECM. Allows for control of Flame On/Off, Flame Height, Fan, Lights, Timer, Thermostat, and Cold Climate functionality.

1. IFT 2.0 System ECM and PACM

This fireplace control system can be configured to multiple installation scenarios, see installation manual for specific wiring.



- 2. ECM, ACM, PACM Power Connections
 - The ACM or PACM is connected to the ECM. The connection is a low-voltage data connection.
 - The ACM or PACM must be connected to 120VAC power source at the appliance J-Box.
 - The ECM must be connected to a 6VDC power source via the AC/DC adapter.
 - Grounding is critical to IFT 2.0 control performance and safety. When servicing a product, <u>always</u> verify that the J-box is securely attached to the appliance chassis.

3. ECM & ACM Features and Descriptions

ECM 2.0 Features			
Pilot Ignition	Orange pilot wire		
Pilot Sense	White pilot wire		
Wi-Fi Module	Wi-Fi Module for use with IntelliFire [®] App		
6V DC	Low Voltage Transformer - Reset Switch connection		
RF Module	Radio Frequency Module for use with RC450/RC150U		
Multi-Wire Multi-wire for connecting Valve, switches, battery backup, etc.			
Stepper Motor	For turn down valves, connects to valve.		
Oxygen Depletion Sensor Power for Oxygen Depletion Sensor			
Pilot Button	Pressing turns pilot on, holding for 10 seconds will reset Wi-Fi Module		
On/Off/Remote Switch	Selector switch for controlling appliance. Remote for use with a remote or Wi-Fi App or wired wall switch.		
50 / 30	Covered selector switch to determine turndown for stepper motor. 50% or 30% based on valve assembly		
LP / NG	Covered selector switch for fuel type selection: Liquid Propane or Natural Gas		
Pairing button	Recessed button in circular hole that will initiate pairing with a remote or reset the ECM.		

ACM & PACM 2.0 Features				
Secondary Burner For use with specific valves for a secondary burner.				
100-240 VAC	Household power from junction box			
FAN	Blower with variable speeds.			
Power Vent Power Vent or Combustion Fan use only: 2 Minute pre-purge; 20 Minute post-purge				
12VDC	Power for LED lights for use			
LIGHT	LED Light controller will auto detect based on load color/white/Realistic LEDs.			
PACM 2.0 Unique Features				
Heat Management 4	Variable speed control: HEAT-ZONE			
Heat Management 3	Variable speed control: HEAT-OUT			
Heat Management 2 On/Off; HEAT-OUT 20 Minute post-purge				
Heat Management 1 On/Off; HEAT-ZONE: 20 Minute post-purge				



4. Remote Control Pairing Instructions and FAQ

VERIFY ALL ELECTRICAL CONNECTIONS <u>BEFORE</u> PAIRING REMOTE TO ECM. BEFORE ATTEMPTING TO PAIR, VERIFY THE FOLLOWING THREE CONDITIONS:

- 1. RF Module must be connected to the ECM. Please note only the RFM 2.0 (2564-120) can properly connect to the ECM 2.0.
- 2. If the ACM or PACM is part of the control installation, it must be connected to the ECM. Both the ACM and PACM must be powered by 120VAC through the junction box at the time of pairing. Verify that the power supply cord is securely connected to the ACM or PACM.
- 3. All loads, including blower, lights, or power vent need to be connected to ACM or PACM.

Note: If a Power Vent or Heat Management connection is lost or removed, the ECM error can persist. See Section 13 for additional information.

4. After pairing, always function test the appliance to ensure the blower, lights, power vent, and/or heat management functions with the remote control.

5. Remote Control Pairing Procedure

- On the IFT-ECM, move the ON/OFF/REMOTE switch to the REMOTE position. The green LED will blink three times. A few seconds later, an audible "beep" will occur to indicate that the system is ready. NOTE: If the green LED continues to blink slowly (system is searching for a clear channel), wait until it stops before proceeding to Step 2.
- 2. Locate the pairing hole on the IFT-ECM. Using a paper clip or similar item, press and release the pairing button. The IFT-ECM will "beep" once and the green LED will blink for up to 60 seconds. During the 60 seconds, it is normal for accessories such as lights or fans to energize momentarily. Verify that optional accessories are being energized. If there is any question, repeat Step 2 to verify the lights, fan, and/or power vent energize. This is required for the IFT control to recognize the loads, which will cause the system to show the correct icons on the touch-screen display.
- 3. While the green LED on the IFT-ECM is blinking:

RC450: Tap anywhere on the gray indicator bar located at the top of the IFT-RC450 screen. On the next screen tap on the pairing function icon.

RC150U: Separate the outer case from the RC150U. To do this, insert a small flat screwdriver in the tab located on the bottom of the wall switch and twist the screwdriver to disassemble the wall switch. Locate the pairing hole on the IFT-ECM. Using a paper clip or similar item, press and release the pairing button. Press and release the pairing button on the RC150U.

- 4. If the remote has been paired successfully to the IFT-ECM, a double audible "beep" will be heard from the IFT-ECM. If the 60 second sequence elapses before the audible double "beep" occurs, repeat the process.
- 6. Re-Pairing RC450 after adding an IFT-ACM, optional RC150U, Fan Kit, Lights Kit, Power Vent, or Heat Management

When adding an accessory to an IFT 2.0 system, the ECM must be powered down and back up to properly detect all newly connected accessory devices.

Ensure that all the wire connections are complete and verify that the ACM or PACM is powered by 120V through the junction box.

IFT 2.0 System will automatically recognize added or removed accessories except for Power Vent and Heat Management ports 1 - 4. Those have a special error handling strategy in the event they are detected and then removed. See Section 13 for additional information.

FAQ: Why does my RC450 screen lock-up with the "Now pairing remote to product" lcon?



Answer: The RC450 has been previously paired to its IFT-ECM, but the RC450 has lost communication with its IFT-ECM. There are two common causes for this issue:

- 1. The appliance was shipped from the factory with IFT-ECM set in 'OFF' mode, and/or the master reset switch is 'OFF'. In either condition, the IFT-ECM does not have power, so it cannot communicate with the RC450.
- 2. There is no power to the appliance, such as the circuit breaker switched off, or a power outage.

Take the following steps to restore communication between the RC450 and the IFT-ECM:

- 1. Verify that there is power to the appliance, and that the 6V AC/DC adapter is securely plugged into the junction box. If there is a power outage, install new batteries into the 4xAA pack.
- 2. Verify all electrical connections at the IFT-ECM control.
- 3. Verify that the RF Module is securely connected to the IFT-ECM.
- 4. Verify that the IFT-ECM is switched to 'REMOTE' mode, and the master reset switch is 'ON'.
- 5. Verify that the IFT-ECM is NOT slow blinking green if it is, wait until it stops blinking (ECM is searching for a clear communication channel).
- 6. Install fresh batteries into the RC450. Verify the RC450 reconnects to the IFT-ECM within four minutes.

Why does 'Fan Speed' Icon not display after pairing?

Answer: The 'Fan Speed' Icon will not display on the main menu screen unless the Flame ON is active. Turn the Flame ON to verify the 'Fan Speed' Icon is on the display.

Why does 'Fan Speed' or 'Lights' not display after pairing?

Answer: The most common cause is that the ECM did not detect the Fan and/or Lights during pairing. This most often occurs when the IFT-ACM does not have power, or either the Lights or Fan are not connected to the IFT-ACM. In these scenarios, the ECM cannot detect the load(s) during pairing. It is unlikely that this is caused by the RC450 or RF Module.

Take the following steps to troubleshoot this issue:

- 1. Verify that the IFT-ACM is securely latched to the IFT-ECM.
- 2. Verify that the IFT-ACM power cord is securely connected to the back of the IFT-ACM.
- 3. Verify that the IFT-ACM power cord is plugged into the live receptacle on the junction box.
- 4. Verify that the Lights and/or Fan(s) are plugged into the IFT-ACM. Any 12V power cord is connected as well.
- 5. Re-pairing the remote is only needed if the RF Module or remote control has been replaced.
- 6. If steps 1-5 didn't fix the problem, replace the IFT-ACM.

Why does the green LED blink for a while after the IFT-ECM is switch to 'Remote' mode?

Answer: The IFT-ECM is searching for a secure RF channel and seeking to minimize interference. This is normal. This channel scan can sometimes take up to several minutes. The technician should wait for the channel scan to complete, before attempting to establish RC450 communication.

Does the remote control need to be re-paired after a power outage?

Answer: No. The IFT control is designed and tested to remain paired, even after an extended power outage. Once power is restored, or emergency battery backup is loaded with 4xAA batteries, the RC450 will automatically establish communication with its paired IFT-ECM within four minutes. Keep in mind that while the ECM is powered down, if the RC450 is powered up, it does periodically search for its paired ECM. This scanning consumes battery power, even if the remote is otherwise not in use.

What are the common ways to fix a product where the RC450 displays 'Remote Control Communication Error'



Answer: The RC450 has failed to send a command to its connected RFM/ECM. This may mean it has lost communication with its paired ECM. The most common cause is that the ECM has lost power. Verify that the ECM has power, is switched to 'REMOTE' mode, and the Master Reset Switch is 'ON'. Once the ECM has power, the RC450 should automatically pair up to the system within four minutes or upon the screen being woken up by touch.

If the condition persists, follow the installation instructions to re-pair the RC450 to the ECM. If this is unsuccessful, then it is possible that the RF Module is malfunctioning, and the RF Module should be replaced.

System Error Codes & Built-in Diagnostics

The IFT has enhanced system diagnostic capabilities in two forms, the ECM LED Error Codes and the RC450 (if equipped). The authorized service technician shall utilize the information from these sources to direct actions & document the findings.

ECM LED Error Codes

ECM LED Error Codes	Description	
2 Red: 1 Green	IFT-RC450 display: 'Error Pilot Flame', pilot valve solenoid not detected. Technician shall follow applicable Gas Valve Troubleshooting (section 9).	
2 Red: 2 Green	Sparking feedback signal error, spark coil failure. The module has an internal hardware failure that cannot be repaired. Replace the ECM.	
3 Red: 1 Green	IFT-RC450 display: "Appliance Safely Disabled," no ignition and/or flame rectification during ignition trial. Technician shall follow applicable IPI Pilot Ignition and Flame Sensing Rectification (section 9).	
4 Red: 1 Green	110VAC power is connected to the wired wall switch.	
6 Red: 1 Green	ODS Module Error or Heat Management (1-4) Error. ODS Error can occur when ODS Sensor determines oxygen depletion levels are high or the Sensor is malfunctioning. Heat Management Error occurs if a PACM load is disconnected while the load is off with either the Flame ON or Flame OFF. Check HM port connections. See Section 13 for additional guidance on clearing Heat Management related errors in the ECM.	
7 Red: 1 Green	Power Vent port error	

9. Gas Valve Troubleshooting

Pilot won't light, there is no noise or spark, 2 Red/1 Green Lockout.	Pilot solenoid not detected.	Verify that valve harness orange wire is securely connected to pilot solenoid valve. Verify pilot solenoid resistance is between 38 to 42 ohms. If resistance is low, open lead, or shorted, replace valve. Check valve harness wire continuity, if open replace 6-pin harness.
	Valve harness orange wire is not attached to gas valve.	Verify that all wires are correctly installed between the gas valve and the IFT-ECM.
IFT-RC450 displays the following	IFT-ECM is not grounded.	Verify that the black wire from the 6-pin wiring harness on the IFT-ECM is securely attached to the metal chassis.
Call Dealer Error: Pilot Flame	Wire is damaged and open.	Verify continuity of the green and orange valve wires, and the black ground wire. Replace wire harness if open lead exists.
In addition, the LED indicator on the IFT-ECM will flash twice red and once green indefinitely.	Wires damaged due to heat.	Verify that none of the wires are melted, and/or shorted. Replace damaged wiring if it exists.
	Gas valve is damaged.	Verify the pilot valve solenoid resistance by measuring across the pilot spade and any non-oxidized metal surface of the gas valve. If open, or coil resistance less than 38 ohms, replace the gas valve.

Working Supply and Manifold Gas Pressures

- Refer to the appliance rating plate for specified working inlet and outlet pressure for appliance/gastype.
- IFT 2.0 Controls require working pressures within the tolerances on the appliance rating plate. Make any necessary adjustments to the supply working pressure.



Valve Solenoid Resistance Checks

- Gas valve coil resistance is a fast and effective measurement of the valve function.
- Pilot solenoid resistance range 38 42 ohms
- Main solenoid resistance range 58 62 ohms
- If solenoid measures outside of range, or is open, replace the gas valve.
- If solenoid resistance is normal, the valve should not be suspected as direct cause of problem.



Valve Stepper Motor Resistance Checks

- Stepper motor is not serviceable. If it is not functioning properly, you must replace the regulator assembly.
- Stepper motor requires 5 VDC to energize, so it can malfunction during system operation when powered during emergency battery backup. As batteries deplete to < 5 V, the ability to energize the stepper motor is compromised.
- Stepper motor is bi-directional, with two coils, as measured across RED and YELLOW wire pair, and BLACK and BROWN wire pair. Access wires on back of 4-pin connector as connected to the ECM. Each pair should exhibit resistance of 4.5 to 5.5 ohms. If out of range, or open, replace the Stepper Motor Regulator assembly.
- The stepper motor coil resistance is a fast and effective measurement to determine if the valve is malfunctioning. A decision to replace the valve should be based on motor resistance measurements. It is highly unlikely that the ECM is the source of a suspected valve stepper motor issue.



10.AC/DC Adapter Troubleshooting

Symptoms	Possible Cause	Corrective Action
Pilot will not light, there is no	AC/DC adaptor faulty	Verify AC/DC adaptor output voltage
noise or spark		less than 5.5 VDC. or is unstable.
		then the device is faulty and should
IFI-ECIVI abnormal or no function		be replaced
when switched to 'ON' or	No 110-120 VAC power to appliance	Verify AC power available to junction
'REMOTE' mode. (No module		box.
response).		
		Verify AC/DC adaptor is plugged
		into ECM.
		Verify that AC/DC adapter is
		plugged into the correct receptacle
		at junction box.

AC/DC Adapter Voltage Verification

- Set multimeter to Volts DC (VDC).
- Measure output voltage (VDC) of the AC/DC Adapter at the jack plug.
- Verify the output voltage is stable and between 5.7 and 6.3 VDC



11. Pilot Ignition Troubleshooting

Symptom	Possible Cause	Corrective Action
	Incorrect wiring.	Verify 'S' (White) sense wire and 'I' (orange) ignitor wire are connected to correct terminals on IFT-ECM.
Pilot won't light, module clicks but no spark, 3 Red/1 Green Lock out.	Loose connections or electrical shorts in wiring.	Verify no loose connections or electrical shorts in wiring from module to pilot assembly. Verify secure connection between orange 'l' lead and the ECM. Verify wire insulation is not damaged. Verify wires are not grounding out to chassis, pilot burner, or any other metal object. Replace any damaged wires.
	Ignitor gap is too large.	Verify spark gap is approximately 0.095" (2.41 mm) to 0.135" (3.43 mm).
Pilot won't light, there is no noise	No AC power, AC/DC adaptor faulty, backup batteries (if being used) depleted, IFT- ECM slider switch in OFF position.	Verify IFT-ECM slider switch is in ON or remote position. Verify AC power available to junction box. Verify AC/DC adaptor is plugged into junction box and ECM. Verify AC/DC adaptor output voltage is between 5.7-6.3 DC. If battery pack is used, check battery pack voltage is >4.2 V (if not, replace batteries).
or spark.	Shorted or loose connection in system wiring or wiring harness.	Verify system wiring configuration. Remove and reinstall wiring harness that plugs into module. Check continuity of wires in valve wiring harness. Replace any damaged components.
	Poor or no system ground.	Verify black ground wire in valve wire harness is connected to metal chassis of fireplace.
Pilot won't light, there is no noise or spark, 2 Red/1 Green Lockout.	Pilot solenoid not detected.	Check if valve wire harness orange wire is connected to pilot solenoid valve. Check pilot solenoid resistance, nominal is 40 ohms. If open or shorted, replace valve. Check valve wire harness continuity, if open replace 6-pin harness.
Pilot won't light, there is no noise or spark, 2 Red/2 Green Lockout.	Spark coil failure.	Replace ECM.

IFT Ignition Spark Sequence

The IFT-ECM 2.0 has either a 60 or 90 second trial for pilot ignition/rectification, depending on the ECM version level. During pilot ignition and then flame rectification, the module will generate spark discharge at the IPI Pilot Assembly. The IFT-ECM produces semi-continuous spark discharge, *with a two second pause every eight seconds*. In other words, the IFT-ECM is designed to generate a spark at the pilot for eight seconds, followed by a two second pause, followed by another ten second cycle.

8 seconds SPARKING - 2 seconds NO SPARK - repeated for up to 90 seconds

This sequence is normal – do not change the module.



Power Source Effect on Spark Discharge

The power source to the IFT-ECM affects the ignition sparking characteristics. If "weak" or "slow" spark occurs, verify that the power source is 6 +/-0.3 VDC. Reduced voltage, primarily when operating on battery backup, will cause lower spark energy intensity at the pilot. When operating on batteries, replace them with new AA batteries, and verify performance with full battery voltage.

12. Pilot Flame Sense Rectification Troubleshooting

Symptom	Possible Cause	Corrective Action
	No gas supply.	Verify incoming gas line ball valve is 'Open'. Verify inlet pressure is within requirement for gas type used. Contact gas supplier.
Pilot sparking, but will not light, 3 Red/1 Green Lockout.	ECM has poor ground.	Verify wiring, check valve wire harness black wire is securely grounded to metal chassis.
	Gas valve defective.	Check pilot valve solenoid kick and hold voltages during ignition cycle. Kick Voltage should be >1 V, hold Voltage minimum 0.26 V. If voltages are OK, replace gas valve.
Pilot lights but main burner does not light. Pilot continues to spark for then goes into 3 Red/1 Green Lockout.	No flame detected. Flame rectification issue.	Check if white sense lead is securely connected to 'S' terminal of IFT-ECM. Check resistance of sense lead between sense rod tip and connector to IFT-ECM, should be less than 1 ohm - if not, replace pilot assembly. Check the system ground, ensure black wire of the valve wire harness is securely attached to metal chassis. Check wiring for damage. With system OFF, check resistance between tip of sense rod and pilot hood, should be resistance greater than 1 Mega ohm.
	No flame detected or sense rod contamination.	With glass assembly installed, verify pilot flame is engulfing flame sense rod on pilot assembly. Verify inlet gas pressure is correct for gas type. Polish flame sense rod with fine steel wool to remove any contaminants that may have accumulated.
Pilot lights and rectifies, but main burner does not light.	Main valve solenoid.	Check if green wire on the valve wire harness is connected to green main valve solenoid. Check main valve solenoid resistance, nominal is 60 ohms. If open or shorted, replace valve. Verify valve inlet pressure is correct for gas type.
Pilot and main do not light, ECM goes into 7 Red/1 Green Lockout.	Power Vent (PV) Failure.	Power Vent blower defective - check wiring to IFT-ACM or IFT-PACM, check if blower is working. Check if the power vent pressure switch is connected to brown and black wire on the valve wire harness. Check if the pressure switch is closed (shorted) when the power vent blower is running. Refer to power vent troubleshooting instruction in product manual.
Appliance lights and runs for a few minutes then shuts down and/or appliance cycles ON and OFF with less than 90 sec of ON time.	Shorted or loose connection in flame detection circuit.	Check if white sense lead is securely connected to 'S' terminal of IFT-ECM. Check resistance of sense lead between sense rod tip and connector to IFT-ECM, should be less than 1 ohm - if not, replace pilot assembly. Check system ground, ensure black valve harness wire is securely attached to metal chassis. Check wiring for damage. With system OFF, check resistance between tip of sense rod and pilot hood, should be resistance (>1 Mega ohm).

Poor flame rectification or contaminated sense rod.	With glass assembly installed, verify pilot flame is engulfing flame sense rod on pilot assembly. Verify inlet gas pressure is correct for gas type. Polish flame sense rod with 320 grit emery cloth and/or Scotchbrite [™] pad to remove any contaminants that may have accumulated. Verify no soot deposits are in sense rod to pilot hood gap.
Logs are set up wrong.	Remove and re-install logs per the log placement instructions.
Damaged pilot assembly.	Verify the pilot assembly ceramic insulator around the flame sensing rod is not cracked, damaged or loose. Check resistance between tip of sense rod and IFT-ECM connector, should be less than 1 ohm. Replace pilot assembly if damage is detected.

IPI Pilot Flame Sensor Resistance Checks

- Sensor wire resistance is a fast and effective measurement of the pilot function.
- Normal resistance, at room temperature, is < 1 ohm. With this measurement, it is unlikely that the IPI Pilot is the direct cause of delayed flame rectification.
- High resistance of > 1 ohm may affect the rectification sensing rate of the pilot flame. If the sensing rate is slow, and resistance is > 1 ohm, clean and polish the sensor electrode with 320 grit emery cloth or Scotchbrite[™] pad. If this does not improve the sensing rate and lower resistance, then it is likely that changing the pilot will improve reliability.
- Verify that the pilot has not been painted. Never paint the pilot. If re-painting a firebox during service, always cover the pilot to protect it from paint contamination.



Clean and polish the flame sensor with 320 grit emery cloth and/or Scotchbrite[™] pad during service events. This removes oxidation and improves future reliability.

Power Vent Appliance Function Testing with the IFT-RC450

- Activate touch screen on RC450. Touch 'Turn Flame ON' Icon.
- Observe touch screen if the system is configured properly for Power Vent operation, a twominute countdown icon will be displayed next to 'Turn Flame OFF'.



- If the RC450 display is correct, the power vent will be running and the two-minute countdown timer will run, after which the pilot will ignite followed by the main burner. This is referred to as the "pre-purge" timer.
- Touch 'Turn Flame OFF' on the RC450. If the display is incorrect, refer to the troubleshooting section 17. The pilot and main flame will extinguish. The power vent will continue to run for 20 minutes. This is referred to as a the "post-purge" timer.

Power Vent Appliance Function Testing with the RC150U

- Press the upper switch of RC150U.
- Verify that the system is configured properly for power vent operation, the power vent will be running, and a two-minute countdown timer will occur with the Power Vent running, after which the pilot will ignite followed by the main burner.
- Press lower toggle on the RC150U. The pilot and main flame will extinguish. The power vent will continue to run for 20 minutes.

13. Power Vent and Heat Management Port Error Handling

- While the IFT 2.0 system will automatically pair and populate newly added connected peripherals such as power vents, heat management, fan, and others, it also has new error handling for the detected removal of power vent and heat management ports specially.
- Once a power vent or heat management port is determined to be in use by the ECM, it will retain memory of this beyond being powered down and powered back up.
- This is to protect against high heat and other issues that may occur on a system that requires a power vent which has lost its power vent connection, as an example.
- To clear this error, see the steps below.

14. Removing Power Vent or Heat Management ports from an appliance

- To clear an error from a port no longer being used, the following steps must be taken:
 - \circ $\,$ Power down the appliance and verify all the connections.
 - Power on the ECM, reset it by pressing and releasing the "Pairing" pinhole found on the ECM.
 - Wait for the full pairing sequence, which can take up to 60 seconds to complete.
 - Once completed, the RC450 and/or RC150U will need to be repaired to the ECM.
 - If a power vent or heat management port is intended to be used, resolve the issues preventing its connection and detection by the ECM. If a Power Vent or Heat Management port was intentionally removed or was never meant to be used in the first place, skip to the next step.
 - Re-pair the remote to the ECM using the steps found in its Installation Guide.
 - Confirm the appropriate peripherals show up as intended on the RC450.

15.FAQ/Troubleshooting IFT 2.0 Controls with Power Vent

Symptom(s)	Possible Cause(s)	Corrective Action
System will not respond to		
Yokenn win nor respond to 'ON' command. IFT-ECM in lockout with 7 RED: 1 GREEN LED Error Code. RC450 shows 'Call Dealer – Power Vent Error' Message CALL DEALER FIRESIDE HEARTH & HOW 651-452-3399 Error Power ∨ent	 Power Vent Motor Failure Power Vent Over Heating Power Vent Pressure Switch Open Blocked Flue Insufficient Draft IFT-ECM selector switch in 'ON' mode Improperly cleared Error Message. 	 Verify that the wiring within the Power Vent is correct. Verify that the PVI/PVLP/PVV-SLP Cord assembly is correctly connected to the IFT switch wires, and the "PV" port on the IFT-ACM or IFT-PACM. Verify that blower operates during 'ON' command. Verify that the PVI/PVLP/PVV-SLP is correctly installed such that it is properly vented and will not overheat. Verify that venting is connected and sealed properly. Verify termination is not blocked. Verify the Teflon tube between the blower and pressure switch is securely connected. Verify that the 'ON' command is provided with IFT-ECM Clear Error Message requires the On/Off/Remote switch to be moved to Off for 3 seconds before moving back to Remote.
System responds to 'ON' command. After it completes 120 second pre-purge, IFT system fails to rectify proven pilot flame. IFT-ECM in lockout with 3 RED: 1 GREEN LED. RC450 shows 'Call Dealer - Appliance safely disabled' Message	 Pilot rectification failure resulting from: Soot, media, or embers contaminate the pilot and burner. Shorted/melted pilot white 'S' sensor wire Disconnected pilot white 'S' sensor wire Excessive draft turbulence acting on the pilot flame. Oxidation or resistance on the IPI pilot flame sense electrode Supply gas pressure out of specification 	 Verify that the IPI Pilot is clean. If necessary, remove any soot, media, or ember deposits, and clean/polish flame sensor electrode with fine steel wool. If sooting is present, determine possible causes to correct issue. Verify that the IPI pilot white 'S' wire is securely connected to the IFT-ECM and is not melted/pinched/shorted along its length. Replace pilot if damage exists. Verify that the gas supply working inlet pressure is within the specification range. Verify black ground wire in valve wire harness is connected to metal chassis of fireplace. Verify that the pilot flame is not compromised by excessive draft. With glass assembly fully installed, verify that the pilot flame is stable and fully engulfing the flame sensor electrode. Verify that the pilot sensor/wire resistance is < 1 ohm. If > 1 ohm, and flame rectification is occurring slowly, replace the pilot.
Pilot ignites and rectifies flame, but burner fails to light, or does not fully light.	Excessive draft.	 Verify that the glass is properly installed, and all latches are engaged. If applicable, place ember material along the back side of the affected burner ports – that can reduce draft affect and promote ignition.

${\bf 16.} {\sf FAQ}/{\sf Trouble shooting-{\sf Appliance Controlled with RC150U Wireless Wall Switch}$

Symptom	Possible Cause	Corrective Action
The appliance does not respond to	Batteries are depleted.	Verify batteries have sufficient charge.
commands from the IFT-RC150Uand the LED on the IFT-RC150Udoes not blink.	Batteries are incorrectly installed.	Verify batteries are installed in correct orientation as shown on battery receptacle.
The appliance does not respond to	The IFT-ECM is not in "REMOTE" position or is not powered.	Verify the IFT-ECM has the three-way position switch set to REMOTE and is connected to power (AC/DC transformer or batteries)
commands from the IFT-RC150U but the <u>LED blinks</u> .	The IFT-RC150U is not paired to the IFT-ECM.	To pair the IFT-RC150U to IFT-ECM, follow the instructions in installation manual.
Note: In this state, the LED may blink once every 2 seconds for a duration of 2 minutes, every 12 minutes.	There is a power outage, and the appliance is operating with the emergency backup batteries.	Verify that the backup batteries in the appliance are installed in the correct orientation.
	Defective IFT-ECM or RF module.	Replace module.
The IFT-RC150U LED blinks randomly even though no command is given.	Communicating with IFT-ECM.	This is normal operation. The IFT-RC150U communicates periodically with the IFT-ECM to send or receive information.
The IFT-RC150U LED blinks in a pattern of every 3 seconds continuously for longer than 5 minutes.	Low battery indicator.	Replace the batteries in the IFT-RC150U with new batteries.
The appliance turns OFF the flame after extended periods of operation.	9 hour safety shutdown timer.	This is normal operation. The appliance will automatically turn the flame OFF after 9 hours of uninterrupted operation.
	IFT-ECM is not connected to its power source.	Verify IFT-ECM is connected to power and the three-position switch is set to REMOTE. Follow pairing process listed in the installation manual.
IFT-RC150U does not pair with the IFT- ECM.	Noisy radio environment is preventing IFT-ECM and IFT-RC150U from communicating.	The IFT-ECM and IFT-RC150U operate on the 915MHz radio band. Allow up to 10 minutes for the IFT-ECM and IFT-RC150U to establish contact. If the problem does not get resolved, try powering OFF and ON both the IFT-ECM and IFT-RC150U and perform pairing function listed in the installation manual

17.FAQ/Troubleshooting – Appliance Controlled with IFT-RC450

Symptom	Possible Cause	Corrective Action
CALL DEALER FIRESIDE HEARTH & HOME 651-452-3399 Appliance safely disabled Main Menu	No pilot ignition or flame rectification, valve not working, or flame detected before expected. ECM responds with hard lockout, 3Red:1Green Hard Lockout.	Refer to Pilot Ignition Troubleshooting and/or Pilot Flame Sensing Rectification sections 11,12
CALL DEALER FIRESIDE HEARTH & HOME 651-452-3399 Error Power Vent Main Menu	Power Vent or Vacuum switch does not work, or ECM is in manual ON.	See IFT Appliance Equipped with Power Vent Troubleshooting (section 15)
CALL DEALER FIRESIDE HEARTH & HOME 651-452-3399 Error Pilot Flame Main Menu	Pilot Valve Solenoid	Refer to Gas Valve Troubleshooting 9
The appliance does not respond to commands from the IFT-RC450 - display does	Batteries are depleted.	Verify batteries have sufficient charge.
not light up when screen is touched.	Batteries are incorrectly oriented.	Verify batteries are installed in correct orientation as shown on batteries receptacle.
	Child Lock is ON.	Check child lock icon located at the top of the RC450 display. If ON, it will show as a 'locked' symbol. To unlock, remove battery compartment door, locate child lock switch, and move to 'unlock' position. Verify child lock icon on screen is now displayed in 'unlock' position.
	IFT-ECM selection switch is not in "Remote" mode	Verify IFT-ECM selector switch is in "Remote" mode.
The display on IFT-RC450 lights up when screen is touched but it does not respond to commands.	IFT-ECM has had a safety shutdown.	Look for 'diagnostics' icon located at the top of RC450 display. If red, touch anywhere on the gray indicator bar to access a secondary menu and check for any error messages. Address the error messages and power cycle the IFT-ECM by moving the slider switch from REMOTE to OFF and back to REMOTE.

	IFT-RC450 is not paired to IFT-ECM.	Tap anywhere on the gray indicator bar to access a secondary menu and verify if the pairing icon is green. If it is not green, then the RC450 has not been paired yet. Follow Section 4 on pairing to successfully pair the RC450 with the IFT-ECM.
	Optional components such fan, lights or power vent are not installed correctly.	Verify peripheral component connections to IFT- ACM. Follow Section 4 on pairing to successfully pair the RC450 with the IFT-ECM.
IFT-RC450 displays the following message on-screen: No dealer info available	Dealer information not programmed into remote.	Remote will still provide all available functions, and appliance fully available for use. Input dealer information.
IFT-RC450 displays the following message on-screen: Call "Dealer Name & Number" to schedule maintenance. CALL DEALER FIRESIDE HEARTH & HOME 651-452-3399 To Schedule Maintenance Main Menu	300 hrs. of use. Appliance is still fully functional.	The appliance has been burning for 300 hours and is due for maintenance. This message can be cleared, otherwise schedule with installing company to perform maintenance.
	IFT-RC450 is placed at a very short distance or too far away from the appliance.	Try to keep the IFT-RC450 close to the appliance but not directly in front of it.
RC450 is either slow or quick to respond while operating in thermostat mode.	IFT-RC450 is placed in the path of an air draft or vent.	Move the IFT-RC450 away from the direct path of air flow.
	Flame Modulation	The IFT system is designed to automatically adjust the flame intensity based on the difference between the desired room temperature and actual temperature. In thermostat mode, the hearth appliance will start in HI flame, but as the actual temperature approaches the desired set temperature on the remote, the flame intensity will automatically decrease. Automatic flame modulation will result in more control of the temperature but will cause the appliance to cycle OFF/ON less.
The appliance turns OFF the flame after extended periods of operation	9-hour safety shutdown timer	This is normal behavior. The appliance has a safety timer that will automatically turn OFF the flame after nine hours of uninterrupted operation.

	IFT-ECM is not connected to its power source	Verify IFT-ECM is connected to power and the three position switch is set to REMOTE. If operating off battery backup, ensure that all four batteries have sufficient charge.
IFT-RC450 does not pair or un-pair from the IFT-ECM	Noisy radio environment is preventing IFT-ECM and IFT- RC450 from communicating.	The IFT-ECM and IFT-RC450 operate on the 912- 918MHz radio frequency range. Allow up to 10 minutes for the IFT-ECM and IFT-RC450 to establish contact. If the problem is not resolved, try powering OFF and ON both the IFT-ECM and IFT-RC450 and perform pairing function.
IFT-RC450 displays the following message on-screen: Fan will turn on within 3 minutes"	Functioning as intended.	The appliance has a three-minute delay timer before the fan is turned ON. This allows the air surrounding the appliance to be heated before being pushed into the room.
IFT-RC450 displays the following message on-screen: "Replace remote batteries."	Low battery in IFT-RC450.	Install new batteries in the IFT-RC450.
IFT-RC450 screen illuminates but does not turn on. Sounder is activated continuously.	RC450 not receiving enough power from batteries to fully boot up.	It is possible one or more batteries is not charged. Replace all 4 batteries. Also, check battery prongs and terminals for misalignment or damage, which would prevent the remote from receiving full power.
The flame height on the IFT- RC450 does not appear to be doing anything.	Stepper motor is not connected.	Check if the 4-pin wiring harness from the stepper motor is connected to the IFT-ECM.
IFT-RC450 is displaying an incorrect brand.	IFT-RC450 was programmed incorrectly.	Call the dealer to have them program the IFT-RC450 with correct branding. IFT-RC450 is still fully functional, and the appliance is unaffected.
After turning flame ON using display, the flame does not turn ON immediately and instead a two-minute timer is displayed.	Power vent is installed on the appliance.	This is expected behavior and the two-minute timer is called a pre-purge timer. The flame will turn ON at the expiration of the timer.
RC450 displays "Sorry your appliance did not start. Try pressing flame on again". Sorry your appliance did not start. Try again by pressing Flame On. Main Menu	Failed ignition trial on NG Appliance, with ECM set to NG mode.	If this occurs repeatedly, verify gas supply, then gas valve, then pilot flame sensing.
	No power to Appliance	Verify home circuit breaker is on and master reset is on (if equipped).

IFT-RC450 displays the following message	Power Outage	Install new batteries in battery backup.
on-screen: "Remote Control Communication Error."	IFT-ECM Mode	Verify selector switch in "Remote" mode.
	IFT-ECM Power	Verify IFT-ECM connected to AC adapter and AC adapter is plugged into the Junction Box.
	IFT-ACM was newly installed and not paired.	Make sure that the pairing procedure has been followed especially if the IFT-ACM was newly installed.
The IFT-ACM does not respond to commands from the IFT-RC450	The power cord between IFT- ACM and junction box is disconnected.	Make sure the power cable is properly inserted into the IFT-ACM and the junction box.
	IFT-ACM and IFT-ECM are not latched.	Check the connection between the IFT- ACM and IFT- ECM by making sure they are latched together.
IFT-RC450 display the following message on-screen: Call Dealer Error: Fan CALL DEALER FIRESIDE HEARTH & HOME 651-452-3399 Error Fan Main Menu	Convection blower malfunction.	Using an RMS voltage meter, check the voltage coming out of the fan port on the IFT-ACM when the fan is set to highest level on the IFT-RC450. If the voltage measured is close to 120V AC then power down the appliance and install a new fan and verify if the issue has been resolved.
	Fuse in IFT-ACM is blown.	Using an RMS voltage meter, check the voltage coming out of the fan port on the IFT-ACM when the fan is set to highest level on the IFT-RC450. If voltage measured is closer to zero, then replace the IFT-ACM itself
	IFT-ACM is not responding to IFT- RC450.	Follow steps listed in the previous symptom.
	Fan is not plugged into IFT- ACM.	Check wiring and connections
	Spade connectors are mis- wired.	Some fans may be connected to the IFT-ACM using spade connectors. For safety, turn off the power to the appliance and check to see if the wires on either end of the spade connector do not match in color as they might be mis-wired.
IFT-RC450 display the following message on-screen: Call Dealer Error: Lights	Ember/backlighting malfunction.	Using a voltage meter, check the voltage coming out of the lights port on the IFT-ACM when the lights are set to highest level on the IFT-RC450. If the voltage measured is close to 120V AC then power down the appliance and install a new light kit and verify if the issue has been resolved.

CALL DEALER FIRESIDE HEARTH & HOME 651-452-3399 Error Lights Main Menu	Fuse in IFT-ACM is blown. IFT-ACM is not responding to IFT- RC450.	Using a voltage meter, check the voltage coming out of the lights port on the IFT-ACM when the lights are set to highest level on the IFT-RC450. If voltage measured is closer to zero, then replace the IFT-ACM itself.
	Lights are not plugged into IFT- ACM.	Check wiring and connections.
	LED controller is not functioning.	Some appliances come with an LED controller that plugs into the Lights port on the IFT-ACM. Verify its wiring and that it is functioning and if not replace it and verify if the problem is resolved.
Lights are blinking and/or fan and power vent blowers are fluctuating.	Poor quality of power from local power station.	Check with customer if they are also noticing issues with other unrelated appliances and if other lighting fixtures are also blinking/dimming randomly. If so, install a surge suppressor between the hearth appliance and its power source.

Appliance Wi-Fi Control Compatibility

The Wi-Fi Module (2326-137) is compatible with the Electronic Control Module 2.0 (2564-130).

Note: The IntelliFire Wi-Fi module supports 2.4GHz or 2.4GHz / 5GHz dual band Wi-Fi networks only. To check your network frequency, refer to your wireless router manual or contact your internet service provider.

It is not necessary to perform a pairing function when adding a Wi-Fi module to an IFT Control System. It is however necessary to power down the ECM when connecting or re-connecting the Wi-Fi Module. It is also not necessary to perform a pairing function after performing a Wi-Fi configuration reset. The pairing function is only required when adding a new remote control, RFM module, or new accessory. Use the following table to guide pairing of new accessories, remote controls, and Wi-Fi module with IFT Controls:

Re-pair required?	Adding New	Replacing Existing
Lights/Fan or other	VES	NO
Accessories	TLS	NO
ECM	YES	YES
WFM	NO	NO
ACM	NO	NO
RFM	YES	YES
Remote (RC150U/RC450)	YES	YES

Device Operating System Requirements

Android Release 6 or higher iOS Release 12 or higher

Wi-Fi Signal Strength and Interference

Recommended distance from router to appliance is less than 50 feet. It is advisable to have the router auto select both channel and bandwidth. Distance, walls, and other household appliances can cause interference.

Steps to ensure adequate signal strength and reduced interference:

- 1. Speed Test Validate that Internet Service Provider is operating effectively (see below for steps on how to run the speed test).
 - Access the internet from your device and search for "speed test."
 - Position the device next to the appliance where the module will be installed.
 - Run the speed test while in airplane mode and Wi-Fi turned on. Note: Broadband is typically 40 mbs and greater. The WFM may not perform as well as the most recent smartphone, however, on a 2.4 Ghz network it should be very similar.

Strong	>5 megabits per second (mbs)	Successful connection
Moderate	1 to 5 mbs	May require movement of router closer to unit or Wi-Fi extender
Weak	<1 mbs	Requires movement of router closer to unit or Wi-Fi extender

- 2. If possible, move the router to less than 50 feet from appliance.
- 3. If necessary, install a wireless extender within range of the appliance location.

Key Service Best Practices

1. Use the ECM selector switch during service. Do not use the app to turn burner ON/OFF while performing service.

2. Remove power from the appliance before disconnecting or changing controls.

3. Be aware that some error messages will be displayed slower in the App, compared to the RC450. If an appliance is equipped with an RC450, that should be preferred method to capture diagnostic information.

Installing the IntelliFire® App

Instructions can be found in the User Guide (2326-985) shipped with the Wi-Fi module. The user must create an IntelliFire® account after the installation of the IntelliFire® app on the smart device. The user will receive an email confirmation. If the email is not in the user's inbox, they should check their junk or clutter folder.

Primary user: There can only be one primary user. The user that connects the Wi-Fi module in the appliance to the app is the primary user. The primary user can edit, delete appliances, and/or locations associated to that account. The primary user can also allow secondary users to control the appliances.

Secondary user: Can control appliance features. They cannot edit/add location, edit/add appliance, add users, or change brand.

Problem Resolution Steps

- 1. Ensure there is power to the IFT Control System. Have the homeowner use the remote or wall switch to verify normal operation.
- If the ECM and WFM are visible identify their LED indicator. Refer to the table below for the Wi-Fi Module Status LED. If connected to the internet, the WFM should have a solid green LED.
 - a. Verify if the IFT-ECM LED is indicating an error code. If there is an error code on the IFT-ECM LED, refer to earlier content in this document to resolve the condition causing the fault. Once no error code is verified on the IFT-ECM LED, proceed to 2. b. below.
 - b. For # 1,2,4 in the table below, refer to the IntelliFire® App Installation Instructions & User Guide (2326-985) and follow the installation process.
 - c. For # 3 Disconnected from the Internet:
 - i. Have homeowner verify internet is working on a non-cellular Wi-Fi enabled device or a smart phone in airplane mode with Wi-Fi turned on. If the Internet is down, then the homeowner will need to contact their internet service provider.
 - ii. If the internet is working, follow the steps in the Wi-Fi Signal Strength and Interference section above.
 - 1. If this checks out, inquire on any changes to the Wi-Fi Network
 - a. New Service Provider may have required new Router/Network ID and Password
 - b. New Router needs to support 2.4 Ghz Band as outlined in previous sections and the IntelliFire® App Installation Instructions & User Guide.
 - c. Change in Wi-Fi Network ID or Password
 - i. Refer to IntelliFire® App Installation Instructions & User Guide and follow the 'Resetting the Wi-Fi Connection' resolution found in the FAQ section.

19.Wi-Fi Module Status LED

The Wi-Fi module is equipped with an LED that can be used to indicate internet connection and setup status during installation and service.

# B	Sehavior/State/Mode	LED Color: Blink Rate	Corrective Action
1.	Access Point Mode Startup/Reset	GREEN: 0.2 Seconds ON (fast), 1.8 Seconds OFF (fast)	The Wi-Fi module comes in this mode from the factory. The Wi-Fi module is ready to be set up to the smart device. If you open a smart device, you will see IntelliFire_XXXX as an option in your Wi-Fi network settings. Follow the instructions in the installation manual for setup.
2.	Setup Mode connection to Home Network	GREEN: 1.0 Second ON (slow), 1.0 Second OFF (slow)	The Wi-Fi has been set up and connected to the home network but has not made connection to the IFT server yet. Continue with the setup process.
3.	Disconnected from the Internet	GREEN: 1.0 Second ON, 1.0 Second OFF	The Wi-Fi module is setup and was running, but now it will not accept any commands. Check if home network is functional and connected to the internet. This can be a temporary situation, wait a few minutes.
4.	IFT-WFM connected to the Internet and is fully functional	GREEN: ON Solid	Wi-Fi module and app are ready to use and send/receive commands.
5.	Command Sent to IFT- WFM	RED: 0.2 Second on	Wi-Fi module acknowledges command. You will also hear an audible beep.

20. Mobile App Screen Messages Corrective Action

Message on the App Screen	Corrective Action
"An unknown error occurred."	The app ran into an unknown error. Check your home Wi-Fi network connection. Close the app and retry. If this continues to fail, follow the reset configuration steps.
"Appliance Safely Disabled: Your appliance has been disabled. Please contact your dealer and report this issue."	During operation the pilot lost rectification, the appliance has shut down. Contact dealer for service.
"Are you sure all flammable material is removed from in front of the appliance? If so, press OK below. If not, press Cancel."	This is to ensure all material is removed from in front of your appliance. Pressing 'OK' will start the appliance. If you press 'Cancel' the appliance will not turn on.
"Are you sure you want to connect to a network with no password?"	Wi-Fi Network has no password. Typically seen in commercial applications where a firewall system is in place.
"Connected to appliance Wi-Fi network. Appliance Serial: " + serial.	Informational
	Reset the configuration by one of two options:
	If you did not select a network yet and received this error, press Okay and the list of available networks should populate.
	If you had entered an incorrect network password, then you will need to follow one of the two reset configuration options:
"Error: There was an error communicating with the appliance. Verify you are connected to the appliance's Wi-Fi network and try again".	Option 1: Cycle power OFF and back ON to the appliance by accessing the reset switch (if equipped) or its circuit breaker. After the power cycle, wait five minutes, then check to verify that the IntelliFire_xxxxxx system is available in the Wi-Fi settings on your mobile device. Exit the app, and start the setup process from Page 3, step 1.
	Option 2: (Recommend that this is performed by a hearth professional) Press and hold the pilot button on the IFT-ECM for 10 seconds until you hear a long beep. See Figure 1 in Section 10. Option 2 requires partial disassembly of the appliance. After resetting the configuration, exit the app, and start the setup process from Page 3, step 1.
"Fan Error. Your appliance has detected that an accessory is no functional. Please contact your dealer and report this issue."	Fans are not operating correctly. Contact dealer for service.
"Fan will turn on within 3 minutes. Your appliance has a built-in delay that prevents the fan from operating within the first 3 minutes of turning on the appliance. This allows the air to be heated prior to circulation".	Informational
"IFTAPI.net, requires a client certification".	The user should push on the authorization number.
"Invalid email address."	Verify email address is valid.
"Invalid location name"	Location name must be filled out (minimum of 3 characters).
"Invalid password - passwords must be at least 8 characters long and include at least one uppercase letter, lowercase letter, and number."	Follow password rules.
"Invalid password. Please make sure New Password and Confirm Password match."	Re-enter passwords so they match.

Message on the App Screen	Corrective Action
"Maintenance: Your appliance is due for routine maintenance check. Please contact your dealer to ensure your appliance is operating at peak performance."	A 300- hour maintenance reminder. Contact dealer for service.
"Missing appliance name."	Appliance name must be filled out (with a minimum of three characters).
"Password fields must match."	Passwords did not match. Re-enter matching passwords.
"Please check if you have internet access"	Confirm you are connected to your local Wi-Fi network and retry.
"Please enter a valid appliance name and try again."	Appliance name must be filled out (minimum of 3 characters).
"Please try again with a valid email address."	Verify the email address is valid.
"Please verify your device is connected to the internet and try again."	Your Wi-Fi network was not available to app. Ensure Airplane mode is off and/or your Wi-Fi is turned on.
"Pilot Flame Error: Your appliance has been disabled. Please contact your dealer and report this issue."	Pilot failed to light. Call dealer for service.
"Power vent message: "A pre-purge of 120 seconds is required"	Informational as a Power Vent or Smart Wall accessory is connected to the appliance.
"Server unreachable. Please check your internet connection."	Confirm you are connected to your local Wi-Fi network and retry. Confirm if IntelliFire® App has appropriate permissions for Cellular Data usage.
"Sorry your appliance did not start. Try again by pressing Flame ON."	lf problem persists, call your dealer.
"There was a problem adding the user. Please try again with a valid email address."	Verify the email address is valid.
	Sign out and back into the app. If the problem persists, delete your location, delete the app, reset the Wi-Fi module, then try again by re-installing the app and following the IntelliFire® App Installation Instructions.
	Reset the configuration by one of two options:
"There was a problem adding this appliance. It may already exist on your account. Please verify and try again."	Option 1: Cycle power OFF and back ON to the appliance by accessing the reset switch (if equipped) or its circuit breaker. After the power cycle, wait five minutes, then check to verify that the IntelliFire_xxxxxxx system is available in the Wi-Fi settings on your mobile device.
	Option 2: (Recommend that this is performed by a hearth professional) Press and hold the pilot button on the IFT-ECM for 10 seconds until you hear a long beep. See Figure 1 in Section 10. Option 2 requires partial disassembly of the appliance. After resetting the configuration, exit the App, and start the setup process from Step 1, Page 3.
"There was a problem deleting the user. Please try again."	The user is still connected to the account. Ensure there is a good internet connection and try again.
"There was an error adding the location. Verify you have not added this location before and try again."	Close the app and retry. If it continues to fail, delete the app and re-install.
"There was an error communicating with the appliance. Verify you are connected to the appliance's Wi-Fi network."	Your smart device is not connecting to the appliance Wi-Fi module. Make sure your Wi-Fi network is turned on and that there is a good connection.
"There was an error signing you out. Please restart the app."	Close out of the app and re-open.

Message on the App Screen	Corrective Action
"Your appliance has detected that an AUX port or accessory is not functional. Please contact your dealer and report this issue."	An accessory isn't operating correctly. Contact dealer for service.
"Your appliance is currently offline."	Check your wireless network. Confirm your network ID or password has not changed. Also confirm there is power to your wireless router. Can occur after server issues. Power cycling the appliance can help clear this error.
"Your password has been changed. Please log in again."	Confirmation that password was changed. If you don't know password, go through the reset links.
"Your session has timed out. Please log in again."	The allowed access time for the login has expired. You will need to log back into the app.
"ECM Offline" Error Message	Generally, occurs after the Wi-Fi Module has received many errors from the server. Requires a reboot of the ECM itself to clear.

21. Trouble Shooting Mobile App

Symptom	Possible Cause	Corrective Action
Mobile app becomes unresponsive.	Smart device memory issues: other apps are not working well either.	Download updates and restart IntelliFire® App.
		Restart smart device.
I did not hear the second beep during the set-up process.	Selected the wrong Wi-Fi network, did not enter Wi-Fi network password, entered the wrong network password, or weak network signal at the appliance.	Delete the location in the IntelliFire® App. Remove power and then restore the power to your appliance. Re-run the set-up process.
	No power to the ECM /appliance.	Ensure your appliance has power. Ensure the ECM has power.
I do not see the IntelliFire®network.	ECM is not Wi-Fi compatible, No Wi-Fi sticker on ECM.	Order a replacement ECM. Contact
	Appliance is not Wi-Fi compatible.	
I do not see the IntelliFire®network.	Wi-Fi module is not fully plugged into the appliance.	Contact your dealer or if you have access to see the Wi-Fi module, confirm that you can see a green LED light (see figure above for location in appliance). If you do not see the light, make sure the Wi-Fi module is plugged into the control module.
	Smart device has Wi-Fi turned off.	Make sure Wi-Fi is turned on. If your device has airplane mode, ensure that is turned off.
IntelliFire® App set up wasn't successful.	The appliance is already connected to the IntelliFire®network.	Appliance is already connected. Verify you are logged in with correct email address.

Symptom	Possible Cause	Corrective Action	
	Set up failed.	Resetting the Wi-Fi Configuration Cycle power to your appliance and try again. If this fails, follow the steps	
	Wrong Wi-Fi network information was used.	below to reset module. Recommended to be done by a hearth professional.	
	Setup process was interrupted.	 Access the IFT-ECM. Locate the 'PILOT' button on the top of the IFT-ECM. Press and hold the pilot button for 10 seconds. The IFT-ECM will emit one audible beep for 4 seconds. Release the pilot button and verify that 	
	Wi-Fi module is not in setup mode.	 the Wi-Fi module resumes to display one green LED blink every two seconds. 3. If there is location info from previous setup attempt(s), delete it now. 4. It is important to close out all running applications, including 	
	Change of Wi-Fi Network ID or Password caused by new router or by owner.	 the IntelliFire® App, from your smart device. 5. Return to Step 1 of your setup instructions and start over. 	
Cannot log into IntelliFire® App.	Forgot my email address, used wrong email during set up or invalid email used for IntelliFire® App.	Verify you entered the correct email address and password. If you forgot your password, follow the reset	
User can not add/remove	Wrong password was used.	password steps in the app.	
fireplaces.	Only primary user can add/ remove appliances from account.	Verify you are the primary user by going to the user management screen in the app.	
My app crashed and closed out.	Issue with the app performance on your	Confirm you are on the latest software level of the app, if not, update. If this doesn't resolve the issue, delete the	
Wireless network signal is weak by the appliance.	device.	app and re-download from the App Store or Google Play Store.	
		Move the wireless router closer to the appliance.	
Wireless network signal is weak by the appliance.	Too much interference from walls and/or other appliances	Install a wireless extender that works with the current router. This will typically require the setup of a new location for all appliances using this network.	

Symptom	Possible Cause	Corrective Action
Accessories are not showing up on the app.	ACM or PACM has not been paired. The accessory cable has become unplugged.	Verify cables are connected.
Can't add a secondary user.	Secondary user has not created an IntelliFire® account.	Secondary user needs to download the app and create an account.
Users are not receiving emails from IntelliFire® (example: reset password email).	The email is in your junk/spam mail, or your email account security filters prevent you from receiving IntelliFire® emails.	Check your junk/ spam mail. If it's in there, move the email to your main inbox. If it is not there, contact your internet provider or create an email account on another platform (example: gmail.com).
Thermostat function is not working.	You do not have a remote or wall switch to relay the temperature.	Purchase a remote or wall switch.
	Your remote or wall switch was not paired to your appliance.	Pair the remote or wall switch.
	Your remote or wall switch batteries are dead and cannot relay the temperature.	Replace your remote or wall switch batteries.
 Things that may appear to be a bad Wi-Fi Module but are not Too many devices streaming, or just too many active devices. Device is slow, installing updates, the device needs to be re-started. ISP outage. Internet – TC/IP protocol is very robust; however, things do go down. Example Web page that just hangs, you refresh the web site and it works. Another example, only a certain website does not work, others do. 	Interference	Steps to find the cause of interference: Speed Test - Validate that Internet Service Provider is operating effectively. Change channel to select narrow channel (20 MHz) bandwidth (note: this can impact signal strength and slow network speed) Move router closer to appliance. Add wireless extender

22. Additional Troubleshooting Resources and Videos

IntelliFire®WiFi Module and App

Technical Overview of the IntelliFire® App https://myhearthed.com/#/online-courses/f8fa59f5-8929-4589-834d-ce794925dbb7

Installation Best Practices and Troubleshooting

https://myhearthed.com/#/online-courses/5981352a-1b8a-45e5-8c82-f717abca8b2b

Primo II [Placeholder for Primo II Content]